

## 40 CFR Parts 257

### Checklist for Inspection Requirements for CCR Surface Impoundments 257.83 (b)

#### Labadie Power Station – LCPA (Bottom Ash Pond)


##### 1. Annual Inspection

Requirements	Signs of actual or potential structural weakness	Disruptions or potential disruption to the operation and safety of the unit
CCR Unit and appurtenant structures 257.83(b)(ii)	None Observed	None Observed
Hydraulic structures underlying the base of the CCR unit 257.83(b)(iii)	None Observed	None Observed

The 2019 Annual Inspection included a review of available information regarding the status and condition of the CCR unit, including, but not limited to, files available in the operating record in general accordance with 257.83(b)(i).

Minor maintenance items (e.g. animal burrows, ruts, etc.) associated with routine upkeep observed during the 2019 Annual Inspection, presently do not impact the structural integrity of the embankment. Ameren plans to address these items in a timely manner through Ameren's work control process.

Engineer's Seal

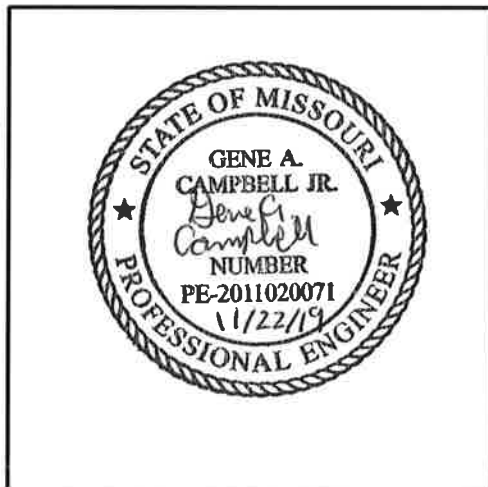

Gene Campbell, P.E.

License: PE- 2011020071

Date: November 22, 2019

**LABADIE ENERGY CENTER**  
Bottom Ash Pond (LCPA)  
Annual Inspection Check Sheet

<b>Date</b>	9/17/2019
<b>Inspector</b>	G. Campbell A. Becker
<b>Pool Level</b>	478.78
<b>River Level</b>	464.1
<b>Temperature</b>	85°F
<b>Weather</b>	Partly Cloudy

**Date of Previous Annual Inspection:** 09/19/2018

**Date of Previous Periodic Inspection:** Not Applicable

**Description of Emergency (EC) or Immediate Maintenance (IM) conditions observed since the last annual inspection:**

None

**Describe any action taken to restore or improve safety and integrity of impounding structure:**

None

**Describe any modifications to the geometry of the impounding structure since the previous annual inspection:**

Pond LCPA is currently being closed.

**Describe any modifications to the operation of the impounding structure since the previous annual inspection:**

Pond LCPA is currently being closed.

**List the approximate remaining storage capacity of the impounding structure:**

Approx. 2,414,961 CY

**List the approximate maximum, minimum and present depth and elevation of the impounded water since the previous annual inspection:**

Max: el. 486.1, depth – 76.2 ft.; Min: el. 474.7 depth – 64.8 ft.

Present: el. 478.8, depth – 68.9 ft.

**List the approximate maximum, minimum and present depth and elevation of the impounded CCR since the previous annual inspection:**

Max. – el. 515 & depth = 105 feet, Min – el. 410 & depth=0ft, Avg depth = 60ft

**Approximate volume of impounded water and CCR at the time of the inspection:**

Approx. 16,325,039 CY

**Describe any changes to the downstream watershed:**

None